



International Carwash Association
Serving the Professional Car Care Industry

401 N. Michigan Avenue
Chicago, Illinois 60611-4267
P 312.321.5199
F 312.245.1085
e-mail: ica@smithbucklin.com
www.CarCareCentral.com

Vehicle Alert - 2005 Ford Expedition Limited and F-150 King Ranch – Powerfold Mirrors

Some 2005 Ford Expedition Limited powerfold mirrors may appear loose, not extend far enough, or become over-extended. This condition will typically occur if the mirrors are moved inward/outward manually (a typical operation performed in a car wash).

To resolve this issue, re-synchronize the mirrors:

- Using the switch, fold the mirrors in. The powerfold switch is incorporated into the 4-way mirror adjustment switch, on the driver's door. To retract/extend the folding mirrors, rotate the mirror adjustment knob to the center position, then press and release the knob.
- A loud 'pop' will be heard indicating re-synchronization. If the pop is not heard, use the knob to retract/extend the mirrors, until the pop is heard.
- After that, the mirrors will operate to their normal positions unless they are moved manually again.

The International Carwash Association would like to thank Ford Motor Company for bringing this important issue to our attention.